

25X1

25X1

NRO REVIEW COMPLETED

[Redacted]

Copy 5 of 11

26 October 1967

MEMORANDUM FOR THE RECORD

SUBJECT: Critique for OXCART Mission Number BX6729

DECLASSIFIED  
Authority NND 023070  
By JWS NARA Date 8/3

1. Mission critique of Mission Number BX6729 conducted in the OSA Control Center at 0930 hours, 25 October 1967.

2. Mission Data:

- a. Mission Number: BX6729
- b. Date Flown: 18 Oct 1967
- c. Area of Operation: North Vietnam
- d. Mission Success: Successful
- e. Pilot's Name: [Redacted]
- f. Aircraft Number: 129
- g. Primary or Spare Flown: Primary
- h. Take-off Time - Planned: 0115Z  
Actual: 0222Z
- i. Landing Time - Planned: 0506Z  
Actual: 0623Z
- j. Time Enroute - Planned: 3+51  
Actual: 4+01
- k. Departure Base: Kadena AB
- l. Landing Base: Kadena AB
- m. Equipment:

(1) Primary: Type I, [Redacted]

(2) Spare: Same as primary.

25X1

25X1

25X1

[Redacted]

25X1

GROUP 1  
Approved For Release 2002/08/20 : CIA-RDP69B00404R000100210001-1  
EXCLUDED FROM AUTOMATIC DOWNGRADING AND DECLASSIFICATION

Approved For Release 2002/08/20 : CIA-RDP69B00404R000100210001-1  
TOP SECRET

25X1

25X1

[Redacted]  
Page 2

3. Operations:

a. Route (INS Plot vs Planned): Satisfactory

(1) Comments: Fuel option taken due to inlet problem and marginal weather at Kadena.

(2) INS Terminal Error: [Redacted]

25X1

25X1

(3) INS Spec Error: [Redacted]

b. Mission Generation & Operational Support: Satisfactory

(1) Comments:

(a) Original take off delayed 48 hours due to Typhoon "Carla".

(b) Take off delayed 1+07 due to heavy rain shower over Kadena at 0115Z.

c. Other comments: Recovery weather 600' broken, 1 1/2 miles visibility in rain. Strip alert tanker launched in case of further weather deterioration and/or a missed approach.

4. Weather:

a. Forecast vs Actual:

(1) As briefed.

25X1

(2) Comments: Catagory II or better forecast. [Redacted] reported cloud cover as 5%. Pilot experienced moderate-severe turbulence over Typhoon "Carla" (at 77M). Terminal weather at Kadena was marginal.

25X1

25X1

~~TOP SECRET~~

[Redacted]  
Page 3

- b. Weather Scout Reporting: Satisfactory
- 5. Intelligence;
  - a. Target Coverage:

- (1) 24 of 24 programmed targets covered.
- (2) 8 first priority SSM targets of 9 covered.
- (3) 19 of 27 first priority NVN COMOR targets covered.
- (4) 153 SAM sites, 16 sites occupied, 1 new site.
- (5) 16 other priority NVN COMOR targets covered.
- (6) Comments: Mission was very productive. Western and northwestern part of North Vietnam that have generally been cloud covered were photographed. The Lao Cai rail yards were approximately 25% filled. No build up of supplies or equipment observed. Photography on the Dien Bien Phu area revealed no SAM or other unusual activity. Most of the rail lines north of the panhandle were covered.

b. Quality of Take: Satisfactory


- (1) Resolution: Good
- (2) Camera Operation: NPIC reported possible Camera malfunction during evaluation of dupe. Evaluation of original negative indicated actual problem to be quality control in preparation of duplications. DIA to take corrective action.

[Large Redacted Block]

[Redacted]

[Redacted]

25X1




25X1



f. Take Movement:

(1) Photography: Satisfactory



25X1

6. Materiel:


a. Aircraft General: Satisfactory

(1) Comments: Right engine spike hammered continuously on second leg over denied. Left engine spike hammered slightly near end of mission. Auto pilot porpoised on second leg over denied.

b. Aircraft Systems: Satisfactory

7. Communications: Satisfactory

a. Message Traffic: Satisfactory




c. UHF/HF Commo: Satisfactory

25X1

8. Outstanding Action Required:


a. D/SA requested photo of storage-training area at Thai Nguyen (Intelligence Division, OSA).




25X1

c. ChiCom altitude reports listed on briefing charts should reflect average altitude at exit denied. Also, suggested that reported vs actual over denied be annotated on chart (Intelligence Division, OSA).

25X1

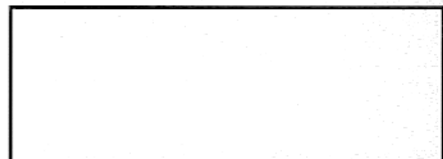

25X1



25X1

~~TOP SECRET~~

25X1

[Redacted]

Page 5

d. Verify corrective action by DIA listed para 5 b (2) (Sensor Systems Division, OSA).

e. Investigate reported milk effect on left windshield after rain repellent used on final approach (Deputy for Materiel, OSA).

f. Request Lockheed assist in analysing current engine inlet problems such as encountered on this mission (Deputy for Materiel, OSA).

25X1

[Redacted]

*for*

Deputy for Operations, OSA

25X1

OXC/O/OSA [Redacted]

DISTRIBUTION:

- #1 - D/SA
- #2 - D/O/OSA
- #3 - D/M/OSA
- #4 - D/R&D/OSA
- #5 - OXC/O/OSA
- #6 - Intel/O/OSA
- #7 - Wea/O/OSA
- #8 - Commo/O/OSA
- #9 - ADP/O/OSA
- #10 - RB/OSA
- #11 - CHRONO

25X1

[Redacted]

25X1

~~TOP SECRET~~